

Work Order ID 62501

Friday, October 01, 2010 9:13:12 AM



Page 1

Item ID: D412-664-203TRN

Accept



Setup Start



Revision ID:

Stop



Item Name: Crosstube Turning Detail

Start Date: 10/1/2010 Start Qty: 1.00



Cust Item ID:

Required Date: 10/14/2010 Req'd Qty: 1.00



Customer:

Reference:

Approvals:

Process Plan:

Date: 10-10-01

Tooling:

Date:

QC:

Date:

SPC (Y/N):

Date:

Run Start



Stop

Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

Draw Nbr

Revision Nbr

D412-664-243

Rev E

100

0.00



MORI SEIKI CNC LATHE LARGE

Mori Seiki

Memo

0.00

amk 10/10/05

1 0

Mori Seiki CNC Lathe Large

1-Fill tube with sand & install plugs DT8534 on both ends as per Folio FA166
2-Turn first side as per Folio FA166
3- File transition lines smooth.

110

0.00



QC1- Inspect dimensions to dimension sheet

QC

Memo

0.00

amk 10/10/06

1 0

Quality Control

120

0.00



MORI SEIKI CNC LATHE LARGE

Mori Seiki

Memo

0.00

amk 10/10/06

1 0

Mori Seiki CNC Lathe Large

1-Turn second side as per Folio FA166
2- File transition lines smooth.
3- Remove sand and plugs
4-Scribe part # and batch # using vibrating stylus

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 62501

Friday, October 01, 2010 9:13:12 AM

Page 2

Item ID: D412-664-203TRN

Accept

Setup Start

Revision ID:

Stop

Item Name: Crosstube Turning Detail

Start Date: 10/1/2010 Start Qty: 1.00

Cust Item ID:

Required Date: 10/14/2010 Req'd Qty: 1.00

Customer:




Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
130  QC Quality Control	QC1- Inspect dimensions to dimension sheet Memo	0.00 0.00				1	8		
140  QC Quality Control	QC8- Inspect parts - second check Memo	0.00 0.00				SC			
150  HandFXtube Hand Finishing Crosstubes	Crosstubes Chemical Conversion Memo	0.00 0.00				1			

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 62501

Friday, October 01, 2010 9:13:12 AM



Page 3

Item ID: D412-664-203TRN

Accept



Setup Start



Revision ID:

Stop



Item Name: Crosstube Turning Detail

Start Date: 10/1/2010 Start Qty: 1.00



Cust Item ID:

Required Date: 10/14/2010 Req'd Qty: 1.00

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Run Start



Stop



Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
160 	QC3- Inspect Part Finish	0.00	SA 10-10-8						
QC Quality Control	Memo	0.00				0			
170 	Packaging	0.00							
Packaging	Memo	0.00				0			
Packaging	Identify and stock in kanban rack Location: LG		SAD 10-10-08						
180 	QC21- Final Inspection - Work Order Release	0.00							
QC Quality Control	Memo	0.00							

10/10/08

MF 10-10-08

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

Friday, October 01, 2010 9:13:15 AM

Page 1

Work Order ID: 62501



Parent Item: D412-664-203TRN



Parent Item Name: Crosstube Turning Detail

Start Date: 10/1/2010

Required Date: 10/14/2010

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP Rev:A 08-03-06 new issue DD verified by:eec
IPP Rev B 08.04.02 Removed polish EC verified by: DD

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
D6009-129		Manufactured	No			120	Each	18.0000	1	1			

Crosstube Material

<u>Location</u>	<u>Loc Qty</u>	<u>Loc Code</u>
LG	18	
38342	2	
→ 53594	16	

1 *WR 10/10/05*

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DART AEROSPACE LTD	Work Order: 62501
Description: Crosstube Assembly (412 High Aft)	Part Number: D412-664-243
Inspection Dwg: D412-664-243 Rev: E	Page 1 of 1

FIRST ARTICLE INSPECTION CHECKLIST

☒ First Article
 ☐ Prototype

Inspection Sheet Drawing Dimension	Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
SIDE A	2.684	+0.005/-0.000	2.689	—	Micro	ML-03
	2.748	+0.005/-0.000	2.753	—	Micro	ML-03
	2.884	+0.005/-0.000	2.889	—	Micro	ML-03
	3.019	+0.005/-0.000	3.024	—	Micro	CNL-05
	3.163	+0.005/-0.000	3.168	—	Micro	CNL-05
	3.308	+0.005/-0.000	3.313	—	Micro	CNL-05
	3.429	+0.005/-0.000	3.434	—	"	"
	2.990	+0.005/-0.000	2.993	—	Micro	ML-03
	2.618	+0.005/-0.000	2.622	—	Vern	ML-7
	0.200	+/-0.010	.203	—	Vern	ML-7
	R0.063	+/-0.010	R.063	—	Rad-gage	REF
	R0.500	+/-0.010	R.500	—	Rad-gage	REF
	4.971	+/-0.030	4.975	—	Vern	ML-7
SIDE B	2.684	+0.005/-0.000	2.688	—	Micro	ML-03
	2.748	+0.005/-0.000	2.753	—	Micro	ML-03
	2.884	+0.005/-0.000	2.889	—	Micro	ML-03
	3.019	+0.005/-0.000	3.022	—	Micro	CNL-05
	3.163	+0.005/-0.000	3.165	—	Micro	CNL-05
	3.308	+0.005/-0.000	3.313	—	Micro	CNL-05
	3.429	+0.005/-0.000	3.433	—	Micro	CNL-05
	2.990	+0.005/-0.000	2.995	—	Micro	ML-03
	2.618	+0.005/-0.000	2.623	—	Micro	ML-03
	0.200	+/-0.010	.205	—	Vern	ML-7
	R0.063	+/-0.010	R.063	—	Rad-gage	REF
	R0.500	+/-0.010	R.500	—	Rad-gage	REF
	4.971	+/-0.030	4.970	—	Vern	ML-7
	124.100	+/-0.020	124.100	—	M-type	ML-9

Measured by: <i>[Signature]</i>	Audited by: <i>[Signature]</i>	Prototype Approval: N/A
Date: 10/10/06	Date: 10/10/06	Date: N/A

Rev	Date	Change	Revised by	Approved
A	04.06.16	New Issue (P/O D412-664-203)	KJ/JLM	
B	06.03.09	Dwg Rev updated	KJ/JLM	
C	07.05.08	Tolerance updated for dimension 4.971	KJ/JLM	
D	10.02.02	Dimension 124.100 was 124.09	KJ	<i>[Signature]</i>

Item	Qty	Part Number	Description
	-243		
1	X	D412-664-243	CROSSTUBE ASSEMBLY (412 HIGH AFT)
2	1	D6009-129	CROSSTUBE
3	2	D3595-063-570	RUBBER CUSHION
4	1	D2896-1	SUPPORT
5	2	D3189-1	CHAFING SHIELD
6	2	D2856-600-1009	ABRASION STRIP
7	4	MS21920-28	CLAMP
8	2	MS21920-30	CLAMP (OR MS21920-32)
9	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)


GENERAL NOTES:

- 1) MATERIAL: MANUFACTURED FROM D6009-129
FINISHED LENGTH = 124.100±0.020 (BEFORE BENDING/TRIMMING)
- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED.
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- 6) IDENTIFICATION: SCRIBE DART PART NUMBER "D412-664-243" AND BATCH NUMBER ON INSIDE OF CUFF USING VIBRATING STYLUS.
- 7) WEIGHT: 47.0 lbs (PER IIN-D212-664)
- 8) PART IS SYMMETRIC ABOUT CENTERLINE.
- 9) RUN CUTTER OFF PART. BLEND OUT EDGE LONGITUDINALLY, TRANSITION SHOULD BE SMOOTH.
- 10) BEND PROGRESSIVELY WITH A MINIMUM OF 8 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 6% BASED ON O.D.
- 11) LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- 12) INSTALL D2896-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 TO THE SURFACE OF D2896-1 THAT WILL BE IN CONTACT WITH THE CROSSTUBE PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 13) INSTALL MS21920-30 CLAMPS (OR -32) WITH D3595-063-570 RUBBER CUSHIONS TO SECURE THE D2896-1 SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMPS ARE OPPOSITE OF CROSSTUBE SUPPORT.
- 14) INSTALL D2856-600-1009 ABRASION STRIPS WITH A 0.13 REF. GAP ON BOTTOM SIDE OF CROSSTUBE PER QSI 035.
- 15) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- 16) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.


WLB 62501

RELEASED
2009-10-29


E	REFORMAT/REVISE GENERAL NOTES; REORGANIZED VIEWS AND REFORMATTED DRAWING TO CURRENT STANDARDS; RELOCATED FLAG #6 PER PAR 08-046 (ZN A6-3); ADD TOLERANCE (ZN B6-3, C4-3, C8-3 & C5-3); MOVED TURNING DETAIL & UPDATED TOLERANCE TO SHEET 4.	RF	09.09.30
D	REMOVE D2732-058, CHANGE TO D3595-063-570	PH	07.03.09
C	REMOVE D2856-600-1087, ADD D2732-058 & MAGNOBOND 6398, MS21920-32 WAS MS21920-30	MB	06.10.27
B	ADD HOLES FOR COMPATABILITY WITH BHT/AA SKIDTUBES	PH	05.02.04
A	NEW ISSUE	PH	01.10.17
REV.	DESCRIPTION	BY	DATE
DESIGN	PH	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	PH	DRAWING NO.	REV. E
MFG. APPR.	PH	D412-664-243	SHEET 1 OF 4
APPROVED	PH	TITLE	SCALE
DE APPR.	PH	CROSSTUBE ASSEMBLY (412 HI AFT)	NTS
DATE	09.09.30	COPYRIGHT © 2001 BY DART AEROSPACE LTD. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

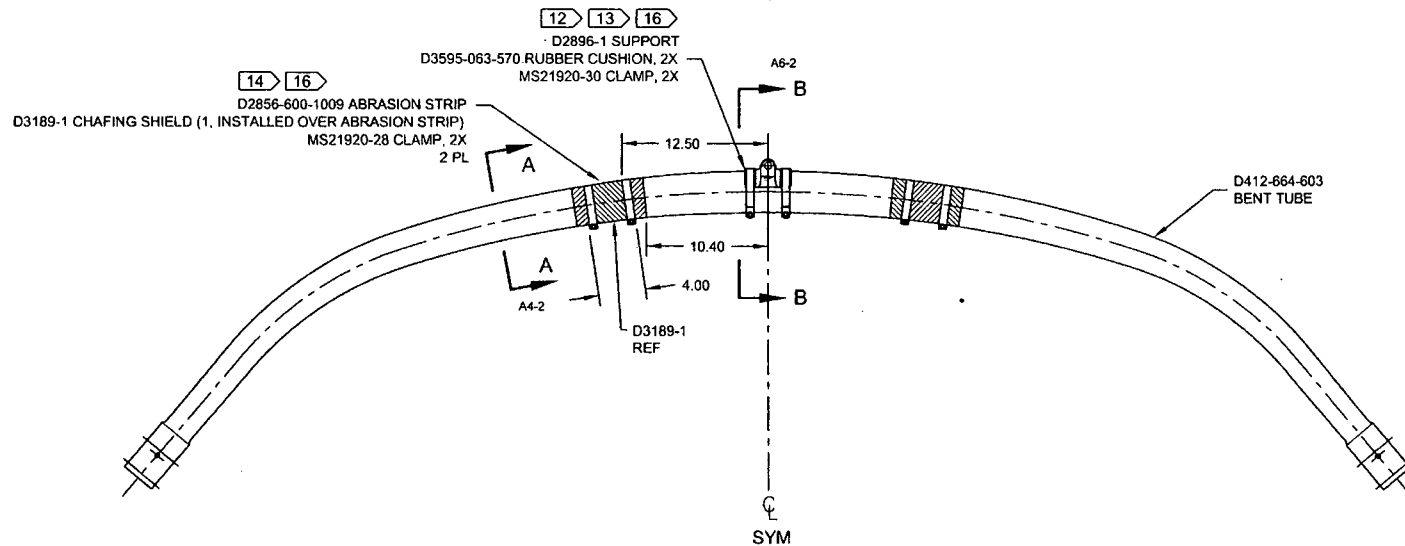

D212-664-243
ASSEMBLY DETAIL

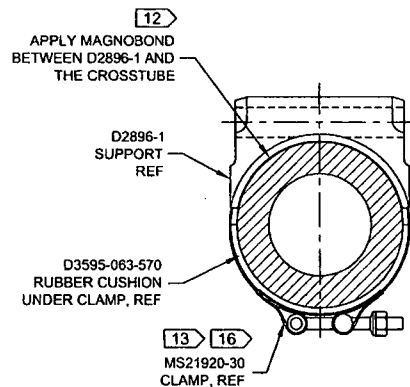

SECTION B-B D4-2
SCALE 4X

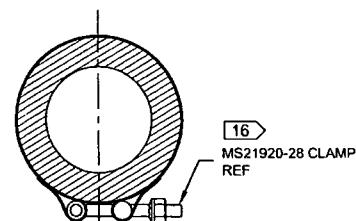


SECTION A-A C6-2
SCALE 4X

RELEASED
2009-10-28
MKB


DESIGN	PH	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	Q	DRAWING NO.	REV. E
MFG. APPR.	B	D412-664-243	SHEET 2 OF 4
APPROVED	10	TITLE	SCALE
DE APPR.	10	CROSSTUBE ASSEMBLY (412 HI AFT)	NTS
DATE	09.09.30	<small>COPYRIGHT © 2001 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMPILED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	

8 7 6 5 4 3 2 1

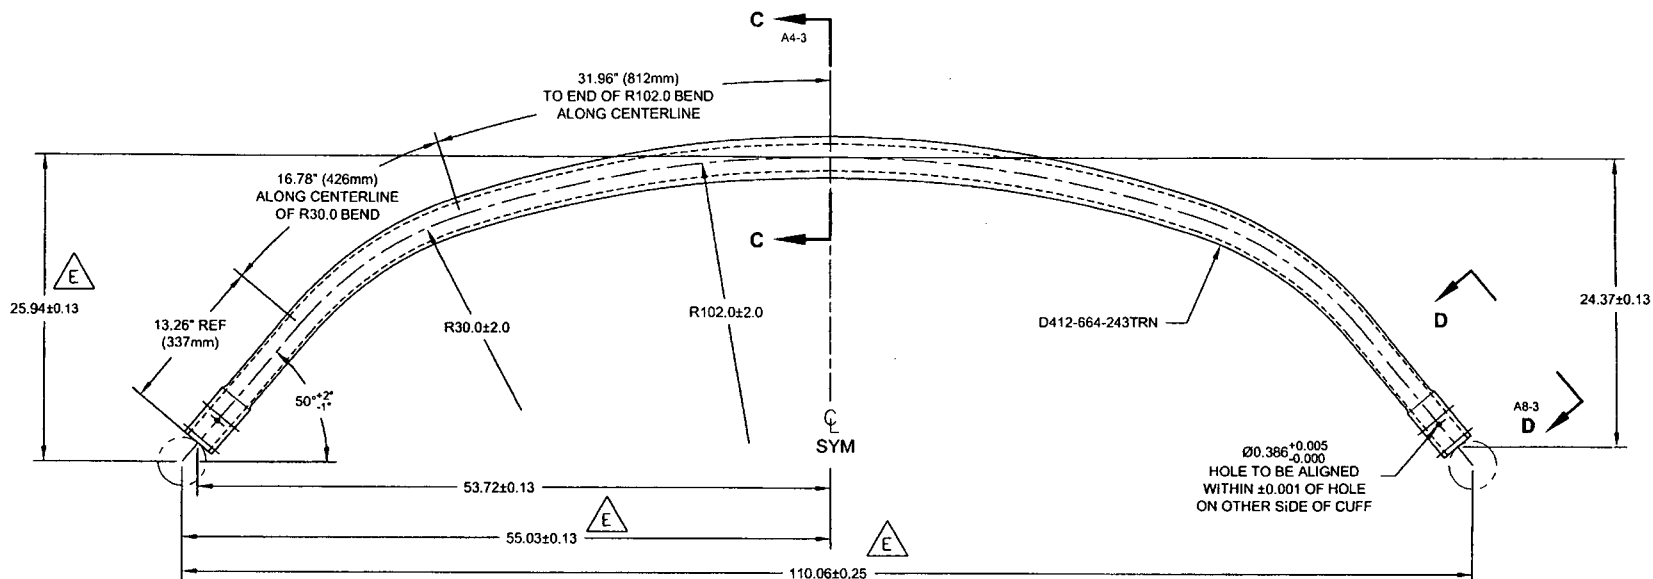


D412-664-603 10
BENDING AND DRILLING DETAIL E

62501

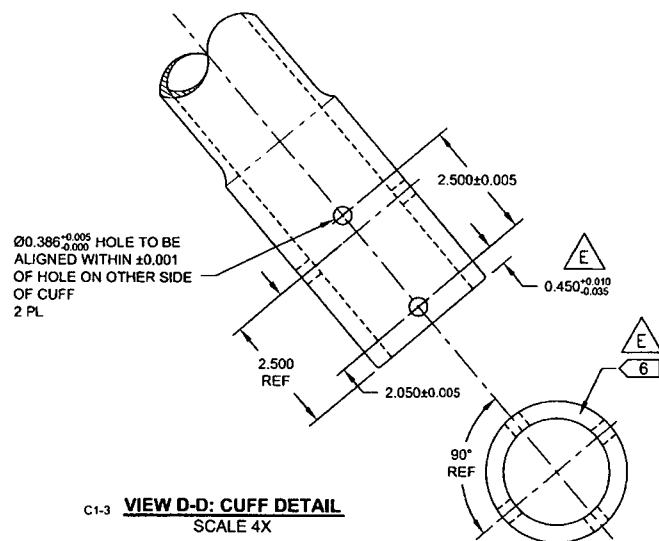

C1-3 VIEW D-D: CUFF DETAIL
SCALE 4X


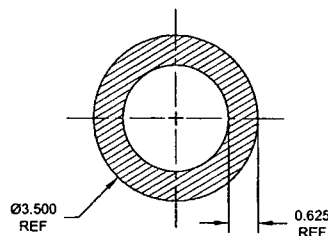


SECTION C-C D5-3
SCALE 4X

RELEASED
 2009-10-29
 MP


DESIGN	PH	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	Q	DRAWING NO.	REV. E
MFG. APPR.	AS	D412-664-243	SHEET 3 OF 4
APPROVED	AD	TITLE	SCALE
DE APPR.	Y	CROSSTUBE ASSEMBLY (412 HI AFT)	NTS
DATE	09.09.30	<small>COPYRIGHT © 2001 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	

8 7 6 5 4 3 2 1

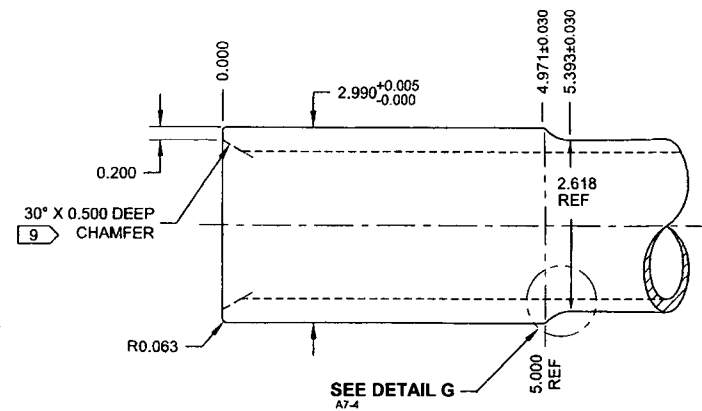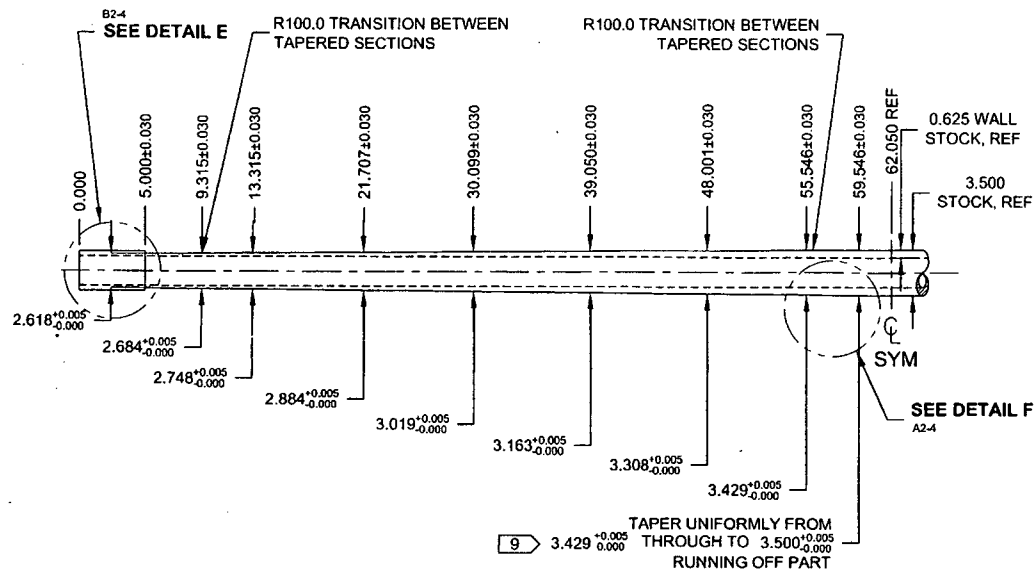


DETAIL E:
CROSSTUBE CUFF D8-4
SCALE 5X

D412-664-243TRN
TURNING DETAIL E

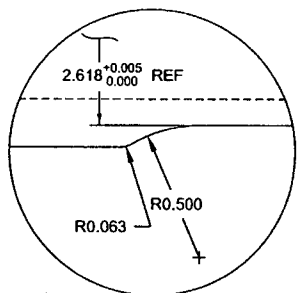

DETAIL G:
CUFF TRANSITION C2-4
SCALE 10X

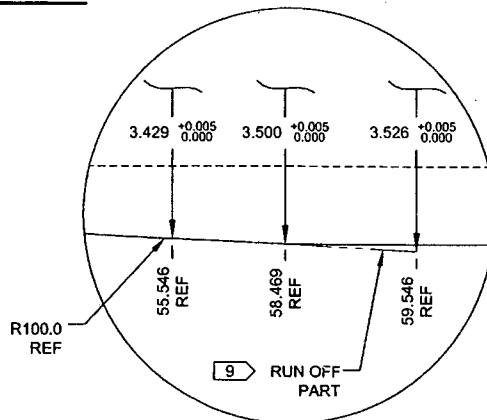

DETAIL F:
TAPER RUN-OFF C4-4
NOT TO SCALE

62501

RELEASED
2009-10-29
MTP

DESIGN	PH	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	RF		
CHECKED	Q	DRAWING NO.	REV. E
MFG. APPR.	DS	D412-664-243	SHEET 4 OF 4
APPROVED	AP	TITLE	SCALE
DE APPR.	TH	CROSSTUBE ASSEMBLY (412 HI AFT)	NTS
DATE	09.09.30	COPYRIGHT © 2001 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	